



## OXYLANCE THERMIC TORCHES (Burning Bars)

**READ ALL SAFETY INFORMATION BEFORE USING**

ALL CUTTING OPERATIONS SHOULD BE PERFORMED IN ACCORDANCE WITH O.S.H.A. 29 CFR, STANDARDS 1910.251, 1910.252, AND 1910. 253 AND ANSI Z49.1:1999 . SEE PAGE 2 FOR ANSI Z49 SAFETY CLOTHING REQUIREMENTS. Observe all company safety policies and the safety policies of the company where cutting is being performed, and all local regulations.

### **SAFETY: READ ALL SAFETY INFORMATION BEFORE USING THERMIC TORCHES (BURNING BARS)**

1. **DO NOT OPERATE THERMIC TORCHES WITHOUT PROPER FIRE RESISTANT CLOTHING. SEE PAGE 2.**
2. **USE ONLY PURE OXYGEN WITH THESE TORCHES. NO OTHER GAS IS REQUIRED.**
3. Inspect all thermic torches (burning bars), holders, and oxygen hose for contamination from oil, grease, or other substances that can have a reaction with pure oxygen. **DO NOT USE CONTAMINATED EQUIPMENT.**
4. Check all parts of oxygen system for leaks. **DO NOT USE CUTTING SYSTEM IF LEAKS ARE PRESENT.**
5. Remove all combustible materials from work area or move work to an area free of combustibles. If project cannot be moved or the fire hazard cannot be removed, use a guard or shield to confine heat, sparks, and hot slag from causing a fire. Provide a fire watch and insure that adequate fire extinguishers are available.
6. Insure that material to be cut contains no flammable or explosive material.
7. Insure that material to be cut contains no substances that will create harmful fumes and/or explosive vapors.
8. Provide fresh air breathing equipment and ventilation where dangerous smoke and fumes may be created.
9. **NEVER USE OXYGEN AS A FRESH AIR BREATHING SUPPLY – USE ONLY APPROVED COMPRESSED AIR**

**IF USING LIQUID OXYGEN, DO NOT USE A SINGLE PORTABLE LIQUID CONTAINER FOR GAS SUPPLY. READ THE ENCLOSED SAFETY PROCEDURES FOR USING LIQUID OXYGEN. REFER TO FLOW CHARTS FOR PRESSURE AND VOLUME REQUIREMENTS. REFER TO MANIFOLD DIAGRAMS FOR SETTING UP DIFFERENT OXYGEN SYSTEMS.**

### **STORAGE AND HANDLING:**

**WARNING: EXPLOSIONS OR FIRE CAN OCCUR WHEN OXYGEN CONTACTS SOME SUBSTANCES.**

Oxylance products are cleaned for Oxygen Service. You **MUST** handle and store Oxylance cutting torches and equipment so they are protected from **contamination from oil, grease, or any substance that may have a reaction with Oxygen.** **NEVER** use any torches, holders, or Oxygen hose that have been contaminated.

### **EQUIPMENT REQUIRED**

1. **FIRE RESISTANT PROTECTIVE CLOTHING, APPROVED FOR FLAME CUTTING OPERATIONS, (SEE PAGE 2).**
2. **Eye protection should be a full-face shield and safety goggles (See Page 2 for ANSI Z49 requirements)**
3. Oxylance Thermic Torches and Oxylance Torch Holder
4. High Flow Oxygen Regulator
5. Oxygen system capable of supplying required **VOLUME** and **PRESSURE** for the size torches being used. **(SEE INSERT DRAWINGS FOR OXYGEN SYSTEMS, FLOW CHARTS AND HOLDER SAFETY)**
6. Oxygen lance hose. Hose I.D. is dependant on length of hose and size torch being used. The minimum recommended hose diameter is 1/2" I.D. Hoses longer than 300' should be larger I.D. to prevent flow restriction.
7. Oxy / Acetylene torch for igniting Oxylance Thermic Torches

### **EQUIPMENT SETUP**

1. Place Oxygen Cylinders in a location protected from heat, sparks, and hot slag. Insure that cylinders are secured so they cannot be turned over or damaged by other equipment operating in the area.
2. Route oxygen hose to protect from heat, sparks, and hot slag from the burning operation. Insure oxygen hose does not create a trip hazard. Insure oxygen hose is protected from damage by other equipment operating in the area. Use an oxygen hose long enough to keep the torch a safe distance from oxygen cylinders.
3. Hook up hoses according to manifold drawing on insert page. Close oxygen valve on holder, turn on oxygen system and check entire system for leaks. **DO NOT OPERATE IF THERE ARE ANY OXYGEN LEAKS.**

**WARNING: DO NOT PERFORM CUTTING OPERATIONS WITHOUT FIRST READING ALL SAFETY MATERIAL ENCLOSED AND REVIEWING OSHA AND ANSI REQUIREMENTS**

The following information on Safety Clothing and Safety in Welding, Cutting and Allied Processes is based on ANSI Z49.1:1999 and OSHA Standard 29 CFR. Portions of this information is reprinted with permission from ANSI / AWS. The complete ANSI Z49 standard is available from Global Engineering at (800) 854-7179, or the American Welding Society, 550 N.W. LeJeune Road, Miami, Florida 33126. For complete copies of OSHA 29 CFR 1910.251, 1910.252, and 1910.253 and all OSHA safety requirements can be downloaded from the World Wide Web at [www.osha-slc.gov](http://www.osha-slc.gov).

---

#### **EYE PROTECTION (ANSI Z49.1:1999 Page 6 PARAGRAPH 4.2.1.2)**

**OXY-FUEL GAS CUTTING:** Goggles or other approved eye protection shall be worn during all oxy-fuel gas cutting operations.

**OXYLANCE RECOMMENDATION:** Due to the amount of spatter and slag from exothermic cutting, OxyLance **REQUIRES** either a tinted full-face shield and clear goggles or a clear full-face shield with tinted goggles. The shade of the tint should be 3 or 4 for thin material (under 1"), 4 or 5 for 1" to 6" material, and 5 or 6 for material over 6" thick.

---

#### **PROTECTIVE CLOTHING (Based on ANSI Z49.1:1999 PAGE 9 PARAGRAPH 4.3 TO PAGE 10 PARAGRAPH 4.6) TO REDUCE THE POTENTIAL OF PERSONNAL INJURY, ALL UNDER GARMETS SUCH AS WORK SHIRTS AND PANTS SHOULD BE COVERED BY FLAME RESISTANT GARMETS AND SHOULD BE FREE OF GREASE AND OIL.**

1. Clothing shall be selected to minimize the potential for ignition, burning, or trapping hot sparks or slag.
2. Clothing shall provide sufficient coverage, and be made of suitable material to minimize skin burns caused by sparks, spatter or radiation. **OxyLance recommends Aluminized clothing designed for repelling sparks or slag and reflecting the heat away from the operator.**
3. **Gloves:** All torch operators shall wear protective flame-resistant gloves. **OxyLance recommends Aluminized Kevlar gloves for the best possible protection. DO NOT USE CLOTH OR THIN LEATHER GLOVES SUCH AS TIG WELDING OR GARDENING TYPE GLOVES.**
4. **Jackets:** Durable **flame-resistant** jackets shall be worn to protect the front of the body. **OxyLance recommends an Aluminized Kevlar Jacket for the best protection from sparks or slag and for its ability to reflect heat away from the operator.**
5. **Leggings:** Flame-resistant leggings or other equivalent means shall be used to give added protection to the legs. **OxyLance recommends Aluminized Kevlar Leggings for the best protection from sparks or slag and for reflecting heat away from the operator.**
6. **Capes and Sleeves:** Cape sleeves or shoulder covers with bibs made of leather or other flame-resistant material shall be worn during cutting operations. **OxyLance recommends an Aluminized Kevlar Jacket for its ability to deflect sparks or slag and to reflect heat away from the operator.**
7. **Other Protective Clothing:** Properly fitted flame-resistant plugs in the ear canals, or equivalent protection, shall be used where hazards to the ear canals exist. Caps made from flame resistant material shall be worn under helmets, when necessary, to prevent head burns.
8. **Noise Control:** Noise shall be controlled at the source when feasible. When control methods fail to bring noise exposure within allowable limits, personal protective devices such as earmuffs or earplugs shall be used.

**Respiratory Protective Equipment:** When controls such as ventilation fail to reduce contaminants to allowable levels or when, implementation of such controls are not feasible, respiratory protective equipment shall be used to protect personnel from hazardous concentrations of airborne contaminants.

1. Only approved respiratory protective equipment shall be used.
2. Whenever the use of respirators is required, a program to establish the proper selection and use of respirators shall be implemented.
3. Compressed air for air supplied respirators or other breathing equipment shall at least meet the Grade D requirements of the Compressed Gas Association ANSI / CGA G-7.1, Commodity Specification for Air. **DO NOT USE OXYGEN FOR BREATHING AIR IN CUTTING AND WELDING APPLICATIONS.**

**Training:** Persons exposed to cutting hazards shall be trained in the use of, and understand the reasons for, protective clothing and equipment.

ACCORDING TO TESTING BY OUTSIDE AGENCIES THE SMOKE AND FUMES FROM OXYLANCE THERMIC TORCHES ARE WITHIN ALLOWABLE EXPOSURE LIMITS, **HOWEVER;** THE MATERIAL THAT IS BEING CUT WITH THE THERMIC TORCHES MAY CONTAIN, OR BE COVERED WITH, SUBSTANCES THAT PRODUCE HAZADORUS SMOKE AND FUMES. **OPERATORS MUST WEAR RESPIRATORY PROTECTION THAT IS SUITABLE FOR THE MATERIAL BEING CUT.**

FOR A COPY OF THE OXYLANCE MSDS SHEET CALL TOLL FREE (800) 333-9906 OR (205) 322-9906. MSDS SHEETS CAN BE DOWNLOADED FROM OUR WEB PAGE AT, [www.oxyLance.com](http://www.oxyLance.com)

## OPERATING INSTRUCTIONS

1. Purge hose and holder prior to putting torch in holder. With holder pointed in a safe direction, slowly crack open oxygen valve and purge hose and holder. Insure full flow with no restrictions.
  2. Oxy lance manufactures thermic torches with three different end finishes. Plain End, no modifications to either end of the outer tube. Expanded End or Quick Connect (QC) has one end of outer tube expanded to allow joining torches together. Threaded and Coupled (T&C) pipe threads on both ends and a pipe collar to join torches together.
  3. Oxy lance torches have a pressed crimp 8 inches from holder end. **CRIMPED** end of the torch goes in the holder. **DO NOT OPERATE WITH WRONG END OF TORCH IN HOLDER.**
  4. Oxy lance torch holders utilize a rubber grommet to seal the torch in the holder. Insert the **CRIMPED** end of torch in the holder. **TORCH (BURNING BAR) MUST BE INSERTED THROUGH THE RUBBER GROMMET AND FULLY SEAT IN APPROPRIATE MACHINED NOTCH IN BASE OF HOLDER (SEE ENCLOSED DRAWING).**
  5. Tighten holder end cap until rubber grommet is fully compressed and torch is secured in holder.
  6. Slowly open oxygen valve to purge torch and check for Oxygen leaks (**DO NOT LIGHT TORCH WITH OXYGEN LEAKS**). Insure oxygen flows freely through torch. **DO NOT ATTEMPT TO LIGHT TORCH WITH RESTRICTED OR NO OXYGEN FLOW.** Close oxygen control valve completely before applying heat to end of torch.
- 

## IGNITING TORCH

Igniting thermic torches requires two people, one to operate the thermic torch and the second to heat the end of torch.

### Thermic Torch Operator

1. Secure thermic torch properly in holder
2. Point torch in safe direction
3. Purge torch and turn oxygen valve off

### Oxy Acetylene Torch Operator / Safety Fire Watch

1. Position operator between end of thermic torch and thermic torch operator (do not get in front of thermic torch)
2. Heat the end of the thermic torch filler material until it is red and dripping molten metal. (With QC rods the fuel wires stop just behind the shoulder of the expansion joint. Cut the expansion off and heat the fuel wires)
3. When tip of torch is properly heated slowly open oxygen valve. Torch will ignite and burn until oxygen is turned off, or torch is consumed to the crimp. **DO NOT BURN PAST CRIMP**
4. While thermic torch operator is working the oxy-acetylene torch operator should standby as a safety / fire watch.

### IF TORCH DOES NOT IGNITE

1. Check Oxygen flow to end of torch. Insure that end of torch is open.
2. Check Oxygen system for proper pressure and volume.
3. Correct problem and repeat ignition process, making sure the end of the torch is properly heated.

Cutting can begin as soon as Thermic Torch is fully ignited. Torch can be extinguished at any time during cutting operation and can be re-ignited. Check oxygen flow prior to applying heat to the tip of partially burned torch.

---

## OXYGEN PRESSURE

Starting oxygen pressure should be 90 to 100 psi. Pre set the regulator and ignite the torch. Adjust pressure with torch burning and oxygen control valve full open. If adequate volume of oxygen is not available, pressure will drop and torch will not burn properly. **DO NOT OPERATE TORCH WITH LOW OXYGEN PRESSURE OR VOLUME.** Proper oxygen pressure can be verified by extinguishing the torch and inspecting burnt end. If pressure is correct the outer tube should be slightly longer than the fuel wires.

Pressure too Low: Fuel wires will burn back inside the outer tube 2 or more inches

Pressure too High: Outer tube will burn back leaving exposed fuel wires.

---

## CUTTING WITH OXYLANCE THERMIC TORCHES

Oxy lance Thermic Torches will rapidly cut most ferrous and non-ferrous metals, as well as concrete and refractory. The cutting speed will depend on the material type and its oxidation rate, or its melting temperature. Materials that do not oxidize have to be melted and blown away. Melting and blowing material away will require an increase in oxygen pressure.

---

## PIERCING

To pierce thick material, start the torch at a slight angle and allow the material to begin to melt. Gradually point the torch straight into the base material and work the torch in and out of the hole. Piercing thick material may cause the outer tube to burn back exposing fuel wires. When piercing, the torch may need to be removed from the hole occasionally to allow the fuel wires to burn off even with the end of the Torch. Oxygen pressure may need to be increased for piercing thick material. Do not exceed the maximum recommended pressure of 150 psi.

## CUTTING TECHNIQUES

For most applications using the drag method of cutting with the tip of the torch pointed back towards the cut will produce the fastest travel speed. Cutting techniques will vary according to the material, thickness, position and direction of cut i.e. flat, vertical, horizontal.

For cutting thick material, operator will need to hold the torch nearly perpendicular to the cut and move the torch in and out of the cut in a sawing motion.

For thin material, the torch can be held at a steep angle to the cut and travel much faster. Operator will have to adjust the Torch angle for optimum cutting speed.

For material such as concrete, refractory, and cast iron, the cutting method is to melt the material and then allow the oxygen pressure to blow the molten material away from the cut. Cutting this type of material will be slower than cutting carbon steel, stainless steel or aluminum and requires higher Oxygen pressure. **DO NOT EXCEED MAXIMUM PRESSURE OF 150 psi.**

---

## CONNECTING TORCHES TOGETHER

On jobs where operators need a longer reach than a standard length torch, or to eliminate wasted torches, two torches can be joined together. QC (Expanded End) and T&C (Threaded and Coupled) Torches are designed for joining two full-length torches or a full-length torch and a partially used torch. **DO NOT JOIN MORE THAN TWO TORCHES TOGETHER.** Joining more than two torches will restrict the oxygen flow and create a safety hazard.

To join torches together:

1. Joining two new torches together; Insert the holder end of one torch in expanded or coupler end of the torch in the holder. For QC torch tap end of torch against solid surface to lock torches together. For T&C torches tighten threaded torch into collar of new torch.
2. For Partial Torches: Remove the partially consumed torch from the holder.
3. Insert the crimped end of the partially burned torch into the Q.C. or T&C end of the new torch.
4. For QC torches tap end of torch against hard surface to lock torches together. For T&C torches thread the crimped end of partially used torch into the coupling end of the new torch and tighten.
5. Open Oxygen valve and check for leaks at the holder and at the joint. Insure free flow of oxygen. Close oxygen valve before lighting.
6. Follow lighting instructions to re-light torch.

---

## SAFETY SUMMARY

1. **ALWAYS** WEAR PROPER FIRE PROOF PROTECTIVE CLOTHING (SEE PAGE 2)
2. **ALWAYS** WEAR PROPER EYE AND FACE PROTECTION (SEE PAGE 2)
3. **NEVER** USE OXYGEN FOR BREATHING – USE ONLY APPROVED COMPRESSED AIR
4. **ONLY USE PURE OXYGEN WITH THESE TORCHES. DO NOT ATTEMPT TO USE AIR OR ANY OTHER GAS**
5. **NEVER** OPERATE TORCHES WITH **OXYGEN LEAKS ANYWHERE** IN THE SYSTEM
6. **NEVER** OPERATE MORE THAN ONE TORCH AND HOLDER PER REGULATOR
7. **NEVER** OPERATE TORCH IF REGULATOR AND HOSE ARE FREEZING UP
8. **NEVER** OPERATE CUTTING TORCHES ALONE. ALWAYS HAVE A FIRE WATCH OR SAFETY PERSON STANDING BY TO ASSIST TORCH OPERATOR
9. **NEVER** STORE THERMIC TORCHES OR RELATED EQUIPMENT WHERE IT CAN BECOME CONTAMINATED WITH OIL, GREASE OR OTHER SUBSTANCES THAT WILL REACT WITH OXYGEN
10. **DO NOT** USE TORCHES OR EQUIPMENT THAT IS CONTAMINATED

For Additional information, please contact:  
**Oxylance Inc.**  
P.O. Box 310280  
Birmingham, AL 35231

Phone (205) 322-9906  
Fax (205) 322-4808  
Toll Free (800) 333-9906

The information in this document is taken from sources or based on data believed to be reliable: however Oxylance Inc. makes no warranty as to the absolute correctness or sufficiency of any of the foregoing or that additional or other measures may not be required under particular conditions.  
Oxylance Inc. 2008

Visit our web page at [www.oxylance.com](http://www.oxylance.com)  
e-mail [info@oxylance.com](mailto:info@oxylance.com)

**Oxylance Inc**

