


Product: Blue Max 3000

Date: 12/3/2007

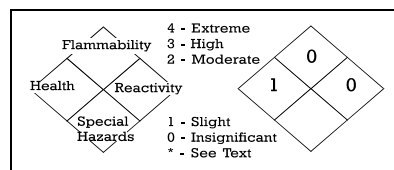

SECTION IV - HEALTH HAZARD DATA

Threshold Limit Value: The ACGIH recommended general limit for Welding Fume NOS - (Not Otherwise Specified) is 5 mg/m³. ACGIH-1999 preface states that the TLV-TWA should be used as guides in the control of health hazards and should not be used as fine lines between safe and dangerous concentrations. See Section V for specific fume constituents which may modify this TLV. Threshold Limit Values are figures published by the American Conference of Government Industrial Hygienists. Units are milligrams per cubic meter of air.

Effects of Overexposure: Electric arc welding may create one or more of the following health hazards:

Fumes and Gases can be dangerous to your health. Common entry is by inhalation. Other possible routes are skin contact and ingestion.

Short-term (acute) overexposure to welding fumes may result in discomfort such as metal fume fever, dizziness, nausea, or dryness or irritation of nose, throat, or eyes. May aggravate pre-existing respiratory problems (e.g. asthma, emphysema).

Long-term (chronic) overexposure to welding fumes can lead to siderosis (iron deposits in lung) and may affect pulmonary function. Manganese overexposure can affect the central nervous system, resulting in impaired speech and movement. Bronchitis and some lung fibrosis have been reported. Chromates may cause ulceration and perforation of the nasal septum. Liver damage and allergic reactions, including skin rash, have been reported. Chromates contain the hexavalent form of chromium. Hexavalent chromium and its compounds are on the IARC (International Agency for Research on Cancer) and NTP (National Toxicology Program) lists as posing a cancer risk to humans. Overexposure to crystalline silica present in any dust from this flux can cause severe lung damage (silicosis). Silicosis is a form of disabling pulmonary fibrosis which can be progressive and may lead to death. Crystalline silica is on the IARC (International Agency for Research on Cancer) and NTP (National Toxicology Program) list as posing a carcinogenic risk to humans. **WARNING:** This product contains or produces a chemical known to the State of California to cause cancer and birth defects (or other reproductive harm). (California Health & Safety Code Section 25249.5 et seq.)

Arc Rays can injure eyes and burn skin. *Skin cancer has been reported.*

Electric Shock can kill. If welding must be performed in damp locations or with wet clothing, on metal structures or when in cramped positions such as sitting, kneeling or lying, or if there is a high risk of unavoidable or accidental contact with workpiece, use the following equipment: Semiautomatic DC Welder, DC Manual (Stick) Welder, or AC Welder with Reduced Voltage Control.

Emergency and First Aid Procedures: Call for medical aid. Employ first aid techniques recommended by the American Red Cross.

IF BREATHING IS DIFFICULT give oxygen. IF NOT BREATHING employ CPR (Cardiopulmonary Resuscitation) techniques.

IN CASE OF ELECTRICAL SHOCK, turn off power and follow recommended treatment. In all cases call a physician.

SECTION V - REACTIVITY DATA

Hazardous Decomposition Products: Welding fumes and gases cannot be classified simply. The composition and quantity of both are dependent upon the metal being welded, the process, procedure and electrodes used.

Other conditions which also influence the composition and quantity of the fumes and gases to which workers may be exposed include: coatings on the metal being welded (such as paint, plating, or galvanizing), the number of welders and the volume of the worker area, the quality and amount of ventilation, the position of the welder's head with respect to the fume plume, as well as the presence of contaminants in the atmosphere (such as chlorinated hydrocarbon vapors from cleaning and degreasing activities.)

When the electrode is consumed, the fume and gas decomposition products generated are different in percent and form from the ingredients listed in Section II. Decomposition products of normal operation include those originating from the volatilization, reaction, or oxidation of the materials shown in Section II, plus those from the base metal and coating, etc., as noted above.

Reasonably expected fume constituents of this product would include: Primarily iron oxide and fluorides; secondarily complex oxides of aluminum, chromium, magnesium, potassium, silicon and sodium. (See MSDS for Lincolnweld or Lincore electrode being used.)

Maximum fume exposure guideline for this product (based on chromium (VI) content) is 1.0 milligrams per cubic meter when used with recommended Lincoln consumables.

Keep exposure as low as possible. Indoors, use local exhaust; outdoors, a respirator may be required.

Maximum respirable dust exposure guideline for this flux (based on crystalline silica) is 1.0 milligrams per cubic meter.

Handle to minimize generation of airborne dust. Use adequate ventilation and dust collection. Use respiratory protection, if required, to keep exposure below limits.

Gaseous reaction products may include carbon monoxide and carbon dioxide. Ozone and nitrogen oxides may be formed by the radiation from the arc.

Determine the composition and quantity of fumes and gases to which workers are exposed by taking an air sample from inside the welder's helmet if worn or in the worker's breathing zone. Improve ventilation if exposures are not below limits. See ANSI/AWS F1.1, F1.2, F1.3 and F1.5, available from the American Welding Society, 550 N.W. LeJeune Road, Miami, FL 33126.

SECTION VI AND VII

CONTROL MEASURES AND PRECAUTIONS FOR SAFE HANDLING AND USE

Read and understand the manufacturer's instruction and the precautionary label on the product. Request Lincoln Safety Publication E205. See American National Standard Z49.1, "Safety In Welding, Cutting and Allied Processes" published by the American Welding Society, 550 N.W. LeJeune Road, Miami, FL, 33126 (both available for free download at <http://www.lincolnelectric.com/community/safety/>) and OSHA Publication 2206 (29CFR1910), U.S. Government Printing Office, Superintendent of Documents, P.O. Box 371954, Pittsburgh, PA 15250-7954 for more details on many of the following:

Ventilation: Use enough ventilation, local exhaust at the arc, or both to keep the fumes and gases from the worker's breathing zone and the general area. Train the welder to keep his head out of the fumes. *Keep exposure as low as possible.* Use adequate dust control measures.

Respiratory Protection: Use respirable fume respirator or air supplied respirator when welding in confined space or general work area when local exhaust or ventilation does not keep exposure below TLV.

Eye Protection: Wear helmet or use face shield with filter lens shade number * or darker. Shield others by providing screens and flash goggles.
* No specific recommendation for submerged arc.

Protective Clothing: Wear hand, head, and body protection which help to prevent injury from radiation, sparks and electrical shock. See Z49.1.

At a minimum this includes welder's gloves and a protective face shield, and may include arm protectors, aprons, hats, shoulder protection, as well as dark substantial clothing. Train the welder not to permit electrically live parts or electrodes to contact skin . . . or clothing or gloves if they are wet. Insulate from work and ground.

Disposal Information: Discard any product, residue, disposable container, or liner as ordinary waste in an environmentally acceptable manner according to Federal, State and Local Regulations unless otherwise noted. No applicable ecological information available.